aiwa

Service Technical Information

MODEL NO.	
	NSX–S222 / S555 series
SUBJECT	
	No compatibility between 4ZG–1 and AZG–1Z8

REF.No. :G – 99 – 050 – E0

DATE :02. NOV. 1999

<CONTENTS>

Two types of CD mechanisms, 4ZG–1 and AZG–1Z8, are used in NSX–S222 and S555 series products.
When repairing the products, note that pick-ups and microcomputers used in 4ZG–1 and AZG–1Z8 are not compatible with each other.

4ZG–1

AZG–1Z8

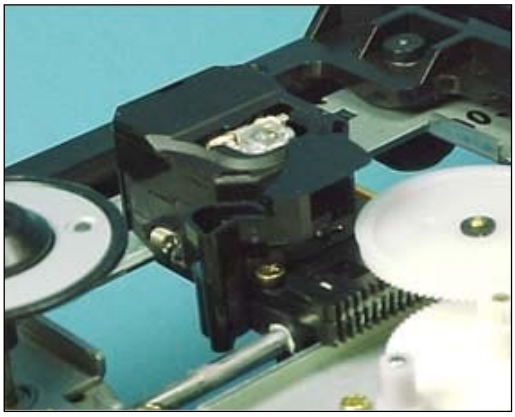

MODEL	4ZG–1	AZG–1Z8
CX–NA222 U CX–NS222 EZ/HC/HR/K/LH CX–NS223 EZ CX–NS226 EZ CX–NS333 EZ/HR/LH CX–NS336 HR	PICK–UP KSS–213F 87–A90–836–010 MICOM M38B59MFH–E110FP 8Z–NF9–631–010	PICK–UP KSS–880(KSM–880CAB) M8–ZZK–C90–070 MICOM M38B59MFH–E116FP 8Z–NF9–633–010
CX–NA555 U CX–NS555 EZ/HA/HR/K/LH/V CX–NS556 EZ	PICK–UP KSS–213F 87–A90–836–010 MICOM µPD780228GF–050 8Z–NF8–729–010	PICK–UP KSS–880(KSM–880CAB) M8–ZZK–C90–070 MICOM µPD780228GF–056 8Z–NF8–677–010

<NOTE>

The pickups used in AZG–1Z8 (KSS–880) are supplied in chassis ASSY (KSM–880CAB).
Replacement of the whole chassis ASSY is required to replace the pickup.

G	R	Code No.	Access Code	Modified Ser. No.	Parts Schedule
–	–	–	–	–	19.Nov.1999